OPERATING AND INSTALLATION INFORMATION

FOR PIEZORESISTIVE PRESSURE TRANSMITTERS



> December 2010

1 General

Please read through this information in detail before installing and commissioning your device. If you still require any information that is necessary for your application, please visit our website: www.keller-druck.com, where you will find detailed datasheets as well as the addresses where you can contact us directly.

2 Function

The presence of the pressure for measurement causes elastic deformation of the silicon diaphragm of the integrated sensor chip. When auxiliary electrical energy is supplied, this deformation is converted proportionally into an electrical signal which can subsequently be evaluated. This information (pressure range/output signal) is shown on the nameplate of the pressure transmitter.

3 Maintenance

KELLER pressure transmitters are maintenance-free, and they operate without errors provided that they are used within the specifications. The recalibration cycle depends on the conditions of use. The recommended cycle is 1 year.

4 Important information

In order to commission the device, you must have the required knowledge of measurement and control technology, and you must also be familiar with the basics of electrical engineering (power circuits). When carrying out assembly and installation work, please comply with the relevant national guidelines, directives and safety regulations. Install the pressure transmitter only on systems which are in the unpressurized state. Always operate the device within the permitted measuring range and/or within the maximum overload. Also in this regard, please pay attention to the relevant operating parameters as stated on the nameplate or in the datasheet. Protect the metal diaphragm against damage. Pay particular attention to this aspect on devices with a flush diaphragm. If the device is not built in, protect the metal diaphragm with the protective cap that is supplied with it.

In respect of pressure transmitters for use in explosive atmospheres, we also refer to the corresponding operating instructions (see 23/25 (S) Ei/26 Ei, 33/35 X Ei / 36 XW Ei, PD-39 X Ei, 41 X Ei and 46 X Ei).


5 Installing the mechanical connection

During the installation process, ensure that the sealing surfaces on the device and the measuring point are clean and free of damage. Only use the appropriate tool to screw the device in and to unscrew it. For available threads, please consult the relevant datasheets at: www.keller-druck.com, or use the links listed in section 8 to access the information directly.

The device should be earthed via the pressure connection. If this is impossible, ensure that adequate earthing is provided via the plug or the cable shield.

Make sure that no moisture can penetrate via the leads. The types of protection stated on the datasheet are valid only for plugs while they are plugged in.

The following illustrations use the example of a device with DIN cubic plug to show the basic connection method for the most commonly used electrical output signals.

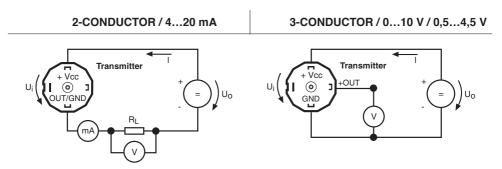

The pin or cable assignments are imprinted on the device's nameplate in each case. You can also find these data on the relevant datasheet at: www.keller-druck.com, or use the links listed in section 8 for direct access to the data.

		2-conductor	3-conductor
Power (voltage) supply	U _i	828 VDC	1332 VDC
Output signal	OUT	420 mA	010 VDC / 0,54,5 V
Load resistance	RL	R _L < (U _i -8) / 0,025 A	$R_L > 5 k\Omega$
Power consumption	1	max. 25 mA	max. 10 mA
(also see the relevant datasheet)			

Lead cross-section

A lead cross-section of 0,25 mm² is entirely adequate for most applications. However, if very long supply leads are required, a power output should be given preference over the voltage signal. This is especially important for high-precision measurements (0,1 %FS) because long connections with voltage outputs produce measuring errors due to the voltage drop over the line resistance. For devices with a voltage output, we therefore recommend that the "ground" (earth) for the measurement should be connected separately (by installing a fourth line) in order to eliminate this measuring error. If this is impossible, a suitably larger cable cross-section should be selected (min. 1 mm² for a cable length of approx. 100 m) in order to reduce the voltage drop over the lines.

For series-specific data, please consult the relevant datasheet at: www.keller-druck.com, or obtain this information directly via the links listed in section 8.

7 Errors / faults

FAULT	POSSIBLE CAUSE	ACTION
No output signal	 No voltage supply Transmitter polarity reversed 	Check voltage supply Connect correctly
	Line break	 Check continuity
Divergent zero point signal	Diaphragm is damaged	Contact the manufacturer; replace the device if necessary
	Operating temperatures are too high/too low	Keep to the permitted temperatures shown on the datasheet
Constant output signal with changing pressure	 Mechanical overload due to overpressure Electrical fault 	Replace the device; in case of repeated failure, consult the manufacturer
Fluctuating signal span	There may be a source of EMC interference in the surrounding area (e.g. a frequency converter)	Remove the source of interference
Signal span drops / is too small	Damage to the diaphragm, e.g. due to impacts, abrasive / aggressive medium; corrosion on the diaphragm / pressure connection; transmission medium not present.	Contact the manufacturer and replace the device

The following list should assist you with the most frequent faults.

8 Links

These links will take you directly to the specific datasheets for each series:

Series 21 C, Series 21 G, Series 21 PY (Pisello), Series 21 Y, Series 22 DT, Series 22 M/S, Series 23 / 25, Series 23 (S)Y / 25 Y, Series 33 X / 35 X, Series PD-39 X, Series 41 X, Series 26 W, Series 26 Y, Series 27 W, Series 36 X W, Series 36 X S, Series 46 X, DCX-16, DCX-18 ECO, DCX-22, DCX-22 AA, Series 25 F, Series 35 X HT(T), Series 35 X HTC, 23 / 25 (S) Ei / 26 Ei, 23 Ed / 25 Ed, 33/35 X Ei / 36 XW Ei, Series PD-39 X Ei, Series 41 X Ei, Series 46 X Ei, LEO 3, FA-23

KELLER

KELLER AG für Druckmesstechnik St. Gallerstrasse 119 · CH-8404 Winterthur Tel. ++41 (0)52 - 235 25 25 · Fax ++41 (0)52 - 235 25 00